

25

Date: Friday, 5/25/2007 8:06:10 AM
 User: Kim Johnston

Process Sheet

Customer : CU-DAR001 Dart Helicopters Services Drawing Name : 206 A/B HIGH GEAR SKIDTUBE
 Job Number : 32558
 Estimate Number : 10161
 P.O. Number : N/A Part Number : D206642211
 This Issue : 5/25/2007 S.O. No. : N/A Drawing Number : N/A
 Prsht Rev. : NC Project Number : N/A
 First Issue : N/A Type : LANDING GEAR Drawing Revision : N/A
 Previous Run : 32256 Material : N/A
 Due Date : 6/20/2007 Qty: 1 Um: Each
 Written By : John.05.28
 Checked & Approved By : John.05.28
 Comment : Est Rev:J 04.08.06 Revised Step 4 per CHG003 KJ/JLM J 0
 4.08.06

Additional Product

Job Number:



Seq. #: Machine Or Operation: Description :

1.0 DC DOCUMENT CONTROL



KS 07-0604 ①

Comment: DOCUMENT CONTROL

Photocopy bluefile & type labels per PPP206-642-211 CHG004

En A/09/23

2.0 32558A HIGH GEAR SKIDTUBE ASSEMBLY 206 A/B



Comment: Sub-Component HIGH GEAR SKIDTUBE ASSEMBLY 206 A/B
 D206-642-241 B 32558A

3.0 PACKAGING 1 PACKAGING RESOURCE #1



Comment: PACKAGING RESOURCE #1
 Pick Packing Kit

4.0 D206651041 206 A/B GHW Kit



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)
 Pick: Packing Kit

Qty Part Number Description Batch

1 D206-651-041 GHW Kit 30235

5.0 D2652 Bushing



Comment: Qty.: 16.0000 Each(s)/Unit Total : 16.0000 Each(s)
 Pick: Packing Kit

Qty Part Number Description Batch

16 D2652 Bushing 32987

En 07/08/130

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Friday, 5/25/2007 8:06:10 AM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 206 A/B HIGH GEAR SKIDTUBE

Job Number: 32558

Part Number: D206642211

Job Number:



Seq. #:

Machine Or Operation:

Description :

6.0

D2655

Ring



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick: Packing Kit

Qty Part Number

Description Batch

1 D2655

Tow Ring

~~B32988~~ B32980 -

7.0

D26651

Saddle, LH Fwd Aft Out



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Pick: Packing Kit

Qty Part Number

Description Batch

2 D2665-1

Saddle

B25915 - \$ 27965 -

8.0

D26661

Saddle, LH, Fwd, Aft, In



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Pick: Packing Kit

Qty Part Number

Description Batch

2 D2666-1

Saddle

B27966 -

9.0

D2712

Set Screw



Comment: Qty.: 10.0000 Each(s)/Unit Total : 10.0000 Each(s)

Pick: Packing Kit

Qty Part Number

Description Batch

10 D2712

Set Screw

B32506 -

10.0

D2884

Saddle Spacer



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

SADDLE SPACER

Batch:

B29453 -

11.0

D2885

Saddle Spacer



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Saddle Spacer

B32626 -

EP 507/08/130

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Friday, 5/25/2007 8:06:10 AM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 206 A/B HIGH GEAR SKIDTUBE

Job Number: 32558

Part Number: D206642211

Job Number:



Seq. #:


Machine Or Operation:

Description :

12.0

AN341A

 Bolt



Comment: Qty.: 8.0000 Each(s)/Unit Total : 8.0000 Each(s)

Pick: Packing Kit

Qty Part Number

Description Batch

8 AN3-41A

Bolt

M103947

13.0

AN45A

Bolt



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick: Packing Kit

Qty Part Number

Description Batch

1 AN4-5A

Bolt

M100857

14.0

AN46A

Bolt



Comment: Qty.: 12.0000 Each(s)/Unit Total : 12.0000 Each(s)

Pick: Packing Kit

Qty Part Number

Description Batch

12 AN4-6A

Bolt

M103962

15.0

AN57A

Bolt



Comment: Qty.: 4.0000 Each(s)/Unit Total : 4.0000 Each(s)

Pick: Packing Kit

Qty Part Number

Description Batch

4 AN5-7A

Bolt

M103389 (1P)

M104374 (3x)

16.0

AN511A

Bolt



Comment: Qty.: 4.0000 Each(s)/Unit Total : 4.0000 Each(s)

Pick: Packing Kit

Qty Part Number

Description Batch

4 AN5-11A

Bolt

M104289

17.0

AN644A

Bolt



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Pick: Packing Kit

Qty Part Number

Description Batch

2 AN6-44A

Bolt

M102079

EP 07/18/13

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Friday, 5/25/2007 8:06:10 AM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 206 A/B HIGH GEAR SKIDTUBE

Job Number: 32558

Part Number: D206642211

Job Number:



Seq. #:

 
Machine Or Operation:

Description :

18.0

AN960JD10

Washer



Comment: Qty.: 8.0000 Each(s)/Unit Total : 8.0000 Each(s)

Pick: Packing Kit

Qty Part Number

Description Batch

8 AN960JD10

Washer

17104855

19.0

AN960JD416

Washer



Comment: Qty.: 25.0000 Each(s)/Unit Total : 25.0000 Each(s)

Pick: Packing Kit

Qty Part Number

Description Batch

25 AN960JD416

Washer

17104215

20.0

AN960JD516

Washer



Comment: Qty.: 8.0000 Each(s)/Unit Total : 8.0000 Each(s)

Pick: Packing Kit

Qty Part Number

Description Batch

8 AN960JD516

Washer

17104156

21.0

AN960JD616

Washer



Comment: Qty.: 4.0000 Each(s)/Unit Total : 4.0000 Each(s)

Pick: Packing Kit

Qty Part Number

Description Batch

4 AN960JD616

Washer

17104374

22.0

MS21042L3

Nut



Comment: Qty.: 8.0000 Each(s)/Unit Total : 8.0000 Each(s)

Pick: Packing Kit

Qty Part Number

Description Batch

8 MS21042L3

Nut (or -3)

17104936

23.0

MS21042L4

Nut



Comment: Qty.: 12.0000 Each(s)/Unit Total : 12.0000 Each(s)

Pick: Packing Kit

Qty Part Number

Description Batch

17104108/1.3 @

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes ☒ No ☐ DQA: ☒ Date: 07/08/24
 QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			
07-08-14	19.0	1x AN960SD416 missing to complete Qty 25.	Q51012	Add Qty 1 of AN960SD416 to k.it. BSM 104215	Q51012 07/08/14	Q51012 07-08-14	Q51012	07-08-14

NOTE: Date & initial all entries

Date: Friday, 5/25/2007 8:06:10 AM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 206 A/B HIGH GEAR SKIDTUBE

Job Number: 32558

Part Number: D206642211

Job Number:



Seq. #:

Machine Or Operation:

Description :

12 MS21042L4 Nut (or -4) *M102552 -*

24.0

MS21042L6

Nut



Comment: Qty.: 2.0000 Each(s)/Unit Total: 2.0000 Each(s)

Pick: Packing Kit

Qty Part Number

Description Batch

2 MS21042L6 Nut (or -6) *M101600 -*

25.0

QC4

INSPECT 100% KITS FOR COMPLETENESS



Comment: INSPECT 100% KITS FOR COMPLETENESS

26.0

PACKAGING 1

PACKAGING RESOURCE #1



Comment: PACKAGING RESOURCE #1

Identify and pack for shipping as per PPP D206-642-211

Location: *Room D 7/8/14 SP*

27.0

QC21

FINAL INSPECTION/W/O RELEASE



Comment: FINAL INSPECTION/W/O RELEASE

Job Completion



W 5708-24

32558A

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

25

Date: Friday, 5/25/2007 8:07:04 AM
 User: Kim Johnston

Process Sheet

Customer : CU-DAR001 Dart Helicopters Services Drawing Name : HIGH GEAR SKIDTUBE ASSEMBLY 206 A/B
 Job Number : 32558A
 Estimate Number : 10163
 P.O. Number : *N/A*
 This Issue : 5/25/2007 S.O. No. : *N/A*
 Prsht Rev. : NC
 First Issue : *N/A* Type : LANDING GEAR
 Previous Run : 32258A
 Part Number : D206642241
 Drawing Number : D2650 REV E
 Project Number : N/A
 Drawing Revision : E
 Material : *N/A*
 Due Date : 6/20/2007 Qty: 1 Um: Each
 Written By :
 Checked & Approved By : *JP 07.05.28*
 Comment : Est Rev:M 04.12.02 Revised procedural steps KJ/JLM

Additional Product

Job Number:



Seq. #: Machine Or Operation: Description :

1.0 DC DOCUMENT CONTROL



Comment: DOCUMENT CONTROL

Photocopy bluefile & type labels per PPP D206-642-241 CHG003 *N/A*

2.0 D2620 Bent 206 Skidtube



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number Description Batch

1 D2620 Bent Tube 3" OD *B3487**DP 7-5-29*

3.0 D32861 Doubler



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Pick:

Qty Part Number Description Batch

2 D3286-1 Doubler *D32860**Pr 07-07-09 (C)*

4.0 D2647 Cap



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number Description Batch

1 D2647

Fwd Cap *B 29328**BE 07-06-04*

5.0 LANDING GEAR 1 LANDING GEAR RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Deburr Fwd edge of tube *DP 7-5-29*

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Friday, 5/25/2007 8:07:04 AM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: HIGH GEAR SKIDTUBE ASSEMBLY 206 A/B

Job Number: 32558A

Part Number: D206642241

Job Number:



Seq. #:

Machine Or Operation:

Description:

2- Remove ridge on inside of Fwd edge of tube as per Dwg D2650

DP 7-5-29

3-Weld Fwd Cap as per Dwg D2650. Use aluminum rod. Grind D2647 to fit as required.

Pick:

Qty Part Number Description Batch

A/R

Aluminum Rod

M 102421 / M 103794 BE 07-06-04

4-Grind weld flush to cap on top surface only.

BE 07-06-04

5-Cut Aft end as per dwg 2650 from front of tube and Deburr

Pm 07-07-090

6-Remove inner indexing ridge on Aft end of skidtube as per Dwg D2650

Pm 07-07-090

7-Open holes for Aft end cap as per Dwg D2650 with #30 Drill Bit using DT8025.

Pm 07-07-090

8-Drill pilot holes using Dt 8167.

Pm 07-07-090

9-Locate DT8732 from inner Aft saddle hole & 3rd crossbolt hole. Insert D3286-1 doubler using DT8732 & D206-642-241-T1, then locating doubler off of 3/16" holes, cleco DT8732 & doubler leaving DT8732 for added support.

Pm 07-07-090

10- Drill D3286-1 doubler rivet holes in tube using # 40 drill, spot drilling doubler at the same time.

Pm 07-07-090

11-Working from the center out, drill # 30 holes into D3286-1 doubler. Cleco each hole as it is being drilled. Verify angle of holes to accommodate rivet heads.

Pm 07-07-090

12-Remove 3/16" cleco's only and open GHW holes to Ø0.500" as per Dwg D2650

Pm 07-07-090

13-Remove D3286-1 doublers, identify orientation, deburr, then attach them to the workorder

Pm 07-07-090

14-Remove indexing edge using DT8741 as per Dwg D2650

Pm 07-07-120

15-C'sink GHW rivet holes as per Dwg D2650

Pm 07-07-120

6.0

QC6

DIMENSIONAL CHECK



Comment: DIMENSIONAL CHECK

En 2/2/16 01

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Friday, 5/25/2007 8:07:04 AM

User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: HIGH GEAR SKIDTUBE ASSEMBLY 206 A/B

Job Number: 32558A

Part Number: D206642241

Job Number:



Seq. #:

Machine Or Operation:

Description :

7.0

LANDING GEAR 1

LANDING GEAR RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Open crossbolt holes to Ø0.3125" as per Dwg D2650

2-Drill pilot holes using DT8028-3, then open to Ø0.297" as per Dwg D2650. Open Aft cap hole #6.

3-Deburr tube and blow out chips from inside the tube

Pr
07-07-190

8.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

Chemical Conversion Coat as per QSI 005 4.1

Pr 07-07-190

9.0

QC3

INSPECT POWDER COAT/CHEMICAL CONVERSION



Comment: INSPECT POWDER COAT/CHEMICAL CONVERSION

BE 070724

10.0

LANDING GEAR 1

LANDING GEAR RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Open holes to finished size as per Dwg D2650, D2650-3 Drilling Detail (without cutting fluid)

2-C'sink crossbolt spacer holes as per Dwg D2650(without cutting fluid)

3-Deburr and blow out all chips from inside the tube

Pr
0707-24

11.0

QC6

DIMENSIONAL CHECK



Comment: DIMENSIONAL CHECK

BE 070724

12.0

CR3212404

Cherry Rivet



Comment: Qty.: 52.0000 Each(s)/Unit Total : 52.0000 Each(s)

Pick:

Qty Part Number Description Batch

52 CR3212-4-04 Rivet m16896

Pr 07-07-24

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Friday, 5/25/2007 8:07:04 AM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: HIGH GEAR SKIDTUBE ASSEMBLY 206 A/B

Job Number: 32558A

Part Number: D206642241

Job Number:



Seq. #:

Machine Or Operation:

Description :

13.0

D26543

206 I-Beam (Web)



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number

Description Batch

1 D2654-3

Web

B32622

R 7-7-24

14.0

LANDING GEAR 1

LANDING GEAR RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Locate, install and rivet doublers as per Dwg D2650. Micro-shave rivets as required

Pro 07-24 (1)

2-Bond D2654-3 web in place as per QSI 015. Ensure holes line up. Allow 12 Hrs. cure time before cutting

Start Date:

7-7-24

Time:

1:00

Finish Date:

7-7-25

Time:

7:30

R 7-7-24

Pick:

Qty Part Number

Description Batch

A/R Sikaflex-291

M104732

Sikaflex expire date:

8-1-1

15.0

QC5

INSPECT WORK TO CURRENT STEP



Pass go. Hand attach with 41 lbs.



Comment: INSPECT WORK TO CURRENT STEP

En 07/25 (1)

16.0

D2649

Crossbolt Spacer



Comment: Qty.: 18.0000 Each(s)/Unit Total : 18.0000 Each(s)

Pick:

Qty Part Number

Description Batch

18 D2649

Crossbolt spacer

B31926 BE 07-07-25

17.0

D32863

Spacer



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Pick:

Qty Part Number

Description Batch

2 D3286-3

Spacer

B32515 BE 07-07-31

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Friday, 5/25/2007 8:07:04 AM

User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: HIGH GEAR SKIDTUBE ASSEMBLY 206 A/B

Job Number: 32558A

Part Number: D206642241

Job Number:



Seq. #:

Machine Or Operation:

Description :

18.0

LANDING GEAR 1

LANDING GEAR RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Insert D2649 crossbolt spacers. Weld as per QSI 004 and Dwg D2650. Remember to back drill each hole to 0.25" before welding the other side. Use aluminum rod.

Pick:

Qty Part Number Description Batch

A/R Aluminum Rod

*M 104221**BE 07-07-25*

2-Grind welds flush as per Dwg D2650.

DP 7-7-30

3-Using DT8733, insert (2) D3286-3 spacers as per QSI 004 and Dwg D2650. Remember to back drill each hole to Ø0.402" before welding other side. Use SS rod as required.

A/RSS Rod

*NOTE**BE 07-07-31*

4-Counterbore 5/16" x 0.750" deep except 7th hole from Aft end as per Dwg D2650. Deburr

R 7-7-31

19.0

CCR264SS33

Cherry Rivet



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Pick:

Qty Part Number Description Batch

2 CCR264SS3-3 Rivets

*103525**DP 7-7-31*

20.0

M7885343

Rivet



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Pick:

Qty Part Number Description Batch

2 M7885/3-4-3 Rivets

*19099**DP 7-7-31*

21.0

D2680041

Nut Plate



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number Description Batch

1 D2680-041 Nut Plate

*19099**B28935**DP 7-7-31*

W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector	

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Friday, 5/25/2007 8:07:04 AM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: HIGH GEAR SKIDTUBE ASSEMBLY 206 A/B

Job Number: 32558A

Part Number: D206642241

Job Number:



Seq. #:

Machine Or Operation:

Description :

22.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

Install D2680-041 Nut Plate as per Dwg D2650

DP 7-2-31

P10

23.0

QC9

VISUAL WELDING INSPECTION



Comment: VISUAL WELDING INSPECTION

07/08/01 (1)

24.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

Er 07/08/01 (4)

25.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

Pressure wash as per QSI 005

BR/mid 07-08-07

(1)

26.0

POWDER COATING

POWDER COATING



Comment: POWDER COATING

Powder Coat White Gloss (Ref. 4.3.5.1) as per QSI 005 4.3. Make sure Nut Plate Thread is protected using paint screw, and mask GHW studs.

M105068

(1X)

27.0

QC3

INSPECT POWDER COAT/CHEMICAL CONVERSION



Comment: INSPECT POWDER COAT/CHEMICAL CONVERSION

mid 07/08/07

FL 07/08/07 (P)

28.0

D26483

Wearpad



Comment: Qty.: 4.0000 Each(s)/Unit Total : 4.0000 Each(s)

Pick:

Qty Part Number

Description

Batch

4 D2648-3

Wearpad

B31695

FL

29.0

D265613

Wearplate



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number

Description

Batch

1 D2656-13

Wearshoe

B32653

FL 07/08/07 (1)

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes ☒ No ☐ DQA: 12 Date: 07/08/24
 QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)							
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector	
			Initial Chief Eng	Action Description Chief Eng	Sign & Date				
07/08/24	22	the wrong Rivets were pulled from stock (m7885/3-4) and installed in Nut Plate P.C. wrong Rivets were m30x also Human error	<i>[Signature]</i>	- Drill out Rivets and Replace with correct m7885/3-4 m2 <u>B9099</u> - must get only incorrect Rivets were handled wrong	<i>[Signature]</i> 7-7-31	<i>[Signature]</i> 07/08/24	<i>[Signature]</i>	<i>[Signature]</i>	<i>[Signature]</i>

NOTE: Date & initial all entries

Date: Friday, 5/25/2007 8:07:04 AM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: HIGH GEAR SKIDTUBE ASSEMBLY 206 A/B

Job Number: 32558A

Part Number: D206642241

Job Number:



Seq. #:

Machine Or Operation:

Description :

30.0

D265621

Wearplate



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number

Description

Batch

1 D2656-21

Wearshoe

~~B33089~~

B29198.

FL

31.0

D265633

Wearplate



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number

Description

Batch

1 D2656-33

Wearshoe

B32281

FL

32.0

D34291



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number

Description

Batch

1 D3429-1

Wearpad

B31037.

FL

33.0

ALS41032130

Insert



Comment: Qty.: 44.0000 Each(s)/Unit Total : 44.0000 Each(s)

Pick:

Qty Part Number

Description

Batch

44 ALS4-1032-130 Inserts

or (see QSI 017)

M103495

FL

34.0

AN960JD10L

Washer



Comment: Qty.: 44.0000 Each(s)/Unit Total : 44.0000 Each(s)

Pick:

Qty Part Number

Description

Batch

44 AN960JD10L

Washer

M103641

FL 07/08/07 B

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Friday, 5/25/2007 8:07:05 AM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: HIGH GEAR SKIDTUBE ASSEMBLY 206 A/B

Job Number: 32558A

Part Number: D206642241

Job Number:



Seq. #:

Machine Or Operation:

Description :

35.0

MS27039108

Screw



Comment: Qty.: 44.0000 Each(s)/Unit Total : 44.0000 Each(s)

Pick:

Qty Part Number

Description

Batch

44 MS27039-1-08

Screw

M/109118

FL

36.0

D26511

Plug



Comment: Qty.: 18.0000 Each(s)/Unit Total : 18.0000 Each(s)

Pick:

Qty Part Number

Description

Batch

18 D2651-1

Plugs

B31788

FL

37.0

D26513

O-Ring



Comment: Qty.: 18.0000 Each(s)/Unit Total : 18.0000 Each(s)

Pick:

Qty Part Number

Description

Batch

18 D2651-3

O-Rings

B29331

FL

38.0

MS27039406

Screw



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number

Description

Batch

1 MS27039-4-06

Screw M/5194

FL

39.0

AN960JD416

Washer



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number

Description

Batch

1 AN960JD416

Washer

M/103338

FL

40.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1]

1- Install inserts & wearpads as per dwg D2922. Use a drop of Sikaflex inside insert holes before installing wearpad/wearplate.

A/R Sikaflex-291

M/104989

FL 07/08/07 (1)

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Friday, 5/25/2007 8:07:05 AM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: HIGH GEAR SKIDTUBE ASSEMBLY 206 A/B

Job Number: 32558A

Part Number: D206642241

Job Number:



Seq. #:

Machine Or Operation:

Description :

Sikaflex expire date: 08/01

2-Install D2651-3 O-Rings on D2651-1 plugs with Petroleum Jelly and install plugs as per Dwg D2650 (D2650-3 detail). Clean excess adhesive.

3-Install MS27039-4-06 Screw as per DEO 9153.

FL

41.0

D2646

Aft Cap



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number Description Batch

1 D2646

Aft Cap

B31335

FL

42.0

MS27039108

Screw



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Pick:

Qty Part Number Description Batch

2 MS27039-1-08 Screw

M104118

FL

43.0

AN960JD10L

Washer



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Pick:

Qty Part Number Description Batch

2 AN960JD10L

Washer

M103641

FL

44.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

1-Install D2646 Aft Cap and seal with Sikaflex. Clean excess adhesive

A/R Sikaflex-291

Sikaflex expire date:

M104989
08/01

> FL 07/08/07 (P)

2-Wing Walk as per Dwg D2650-3 and QSI 005 4.4

Batch:




M104942

M 07-08-09

(P)

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes ☒ No ☐ DQA: D Date: 07/08/21
 QA: N/C Closed: _____ Date: _____

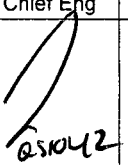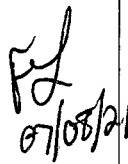NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			
07-08-21	44.0	AP+ cap was installed slightly cracked. Employee tried to adjust it by using a persuasion hammer, and dented the cap. R.C: cap jammed cracked in the tube upon installation.	 07/08/21	SCVAP, check tube & replace B31335 qty 1.	 07/08/21	Er 07/08/21	 07/08/21	Er 07/08/21

NOTE: Date & initial all entries

Date: Friday, 5/25/2007 8:07:05 AM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: HIGH GEAR SKIDTUBE ASSEMBLY 206 A/B

Job Number: 32558A

Part Number: D206642241

Job Number:



Seq. #:

Machine Or Operation:

Description :

45.0

QC3

INSPECT POWDER COAT/CHEMICAL CONVERSION



Comment: INSPECT POWDER COAT/CHEMICAL CONVERSION

Ep 07/08/13 (x1)

46.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

Ep 07/08/13 (x1)

47.0

PACKAGING 1

PACKAGING RESOURCE #1



Comment: PACKAGING RESOURCE #1

Identify and pack for shipping as per PPP D206664241 IF APPLICABLE

Location:

PPP Rev:

PPP 32558

Ep 07/08/25 (1)

48.0

QC21

FINAL INSPECTION/W/O RELEASE



Comment: FINAL INSPECTION/W/O RELEASE

Ep 07/08/04 (1)

Job Completion



u 07-08-24

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

DART

DESIGN <i>UP</i>	DRAWN BY <i>UP</i>	DART AEROSPACE USA, INC. PORT HADLOCK, WA	
CHECKED <i>PH</i>	APPROVED <i>[Signature]</i>	DRAWING NO. D2650	REV. E SHEET 1 OF 5
DATE 06.03.30		TITLE 206/407 SKIDTUBE ASSEMBLIES	SCALE NTS
A	97.03.25	NEW ISSUE	
B	97.06.26	AS MANUFACTURED CHANGES	
C	97.10.29	CHANGE HOLE PATTERN AND FRONT END	
D	04.05.17	REDRAW; INCORP. DE09136/9153/9163 MOD GROUND HNDLNG ON D2650-1/-3	
E	06.03.30	RMV C'BORE, CHG DRILL, ADD CHAMFER	

RELEASED
16 04 17 *[Signature]*

Qty -1	Qty -3	Qty -5	Qty -7	Part Number	Description
X				D2650-1	SKIDTUBE ASSEMBLY
	X			D2650-3	SKIDTUBE ASSEMBLY
		X		D2650-5	SKIDTUBE ASSEMBLY
			X	D2650-7	SKIDTUBE ASSEMBLY
1	1	1	1	D2600-1-160	EXTRUSION
1				D2654-1	WEB
	1			D2654-3	WEB
		1		D2654-5	WEB
			1	D2654-7	WEB
1	1	1	1	D2646	AFT CAP
1	1	1	1	D2647	CAP
16	17	19	23	D2649	CROSS BOLT SPACER
16	18	14	22	D2651-1	PLUG
16	18	14	22	D2651-3	O-RING
1	1	1	1	D2680-041	NUT PLATE
2	2			D3286-1	DOUBLER
2	2			D3286-3	STUD
42	44	54	60	ALS7-1032-130	INSERT (or AKS4-1032-130, ALS4-1032-130, ALS7-1032-130)
2	2	2	2	AN960JD10L	WASHER
2	2	2	2	CCR264SS3-3	RIVET
2	2	2	2	CR3212-4-03	RIVET
2	2	2	2	MS27039-1-08	SCREW
1	1	1	1	MS27039-4-06	SCREW
1	1	1	1	AN960JD416	WASHER
52	52			CR3212-4-04	RIVET

NOTES



- 1) WELD PER DART QSI 004
- 2) DAMAGE TOLERANCE ON FWD BEND:
THERE SHOULD BE NO VISIBLE WRINKLES IN THE BEND FROM THE GROUND TO A HEIGHT OF 25 INCHES ABOVE THE GROUND. IT IS ACCEPTABLE TO POLISH OUT GOUGES UP TO 0.020 DEEP IN THE BENT PORTION OF THE TUBE. A MAXIMUM REDUCTION IN DIAMETER OF 0.150" IS ACCEPTABLE IN THE BENT PORTION OF THE TUBE.
- 3) BOND WEB INTO OUTER TUBE WITH SIKAFLEX-241/-291 ADHESIVE PER DART QSI 015
- 4) INSERT D2651-1 PLUG C/W D2651-3 O-RING IN HOLES MARKED 'P' (BOTH SIDES OF TUBE)
- 5) FINISH:
-CHEMICAL CONVERSION COAT PER DART QSI 005 4.1
-POWDER COAT WHITE (4.3.5.1) PER DART QSI 005 4.3
-BLACK ANTI-SKID PAINT AS INDICATED TO 0.5 ABOVE LOCATION RIDGE PER DART QSI 005 4.4
- 6) DRILL Ø0.297 FOR ALS7-1032-130 INSERTS USING TEMPLATE DT8056-1 ON -1 TUBE, DT8056-3 ON -3 TUBE, DT8056-5 ON -5 TUBE, AND DT8056-7 ON -7 TUBE. INSTALL INSERTS AFTER FINISH.
- 7) TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED

SHOP COPY


RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
NO. 32558A

Copyright © 1997 by DART AEROSPACE USA, INC.

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.

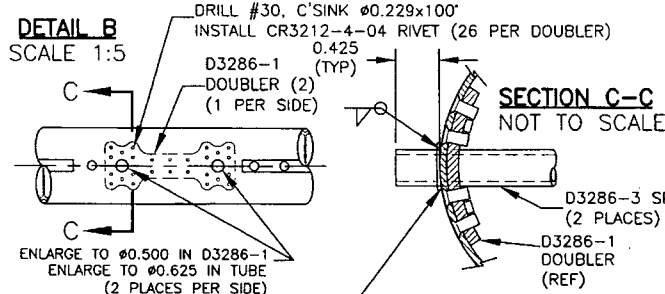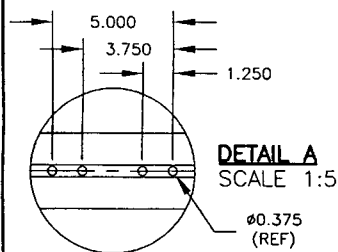



- TO INSTALL D3286-1/-3-:
1. GRIND OFF FLANGE IN AREA SHOWN, FLUSH WITH ROUND TUBE
 2. LOCATE & DRILL D3286-1 DOUBLER USING DT3286-1T1
 3. ENLARGE HOLES IN D3286-1 TO $\phi 0.500$
 4. ENLARGE HOLES IN TUBE TO $\phi 0.625$ AND CHAMFER HOLE $0.030 \times 45^\circ$
 5. RIVET D3286-1 TO TUBE
 6. INSERT D3286-3 SPACER
 7. WELD IN PLACE AND GRIND FLUSH

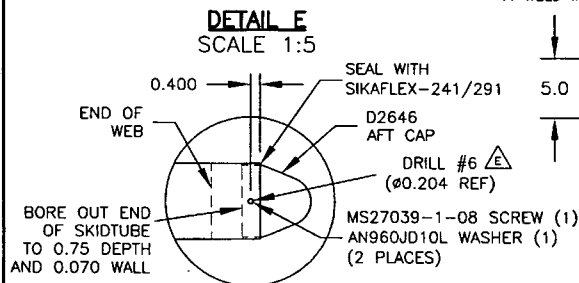

DETAIL F (NOT TO SCALE)

1. CUT TUBE LEVEL
2. REMOVE RIDGE ON FWD SIDE
3. LOCATE D2647 (TRIM AS NECESSARY)
4. WELD D2647 IN PLACE PER DART QSI 004
5. GRIND FLUSH
6. RIVET D2680-041 NUT PLATE IN PLACE







NOTE: MASK THREADS IN D2680-041 PRIOR TO FINISH

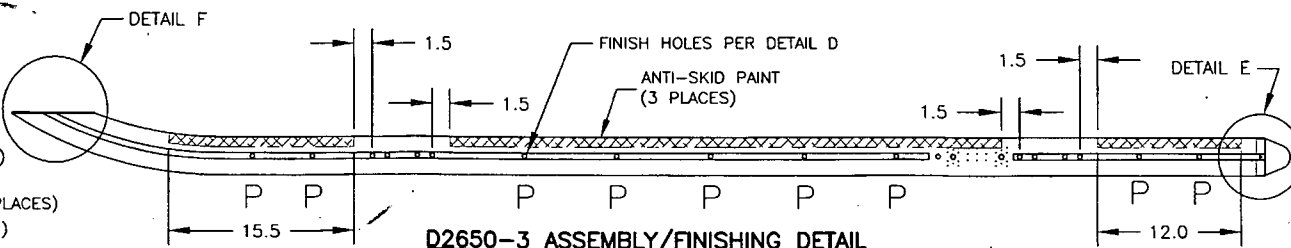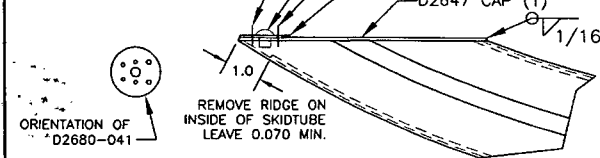

D2650-3 ASSEMBLY/FINISHING DETAIL

COPYRIGHT © 2004 BY DART AEROSPACE USA, INC.		DESIGN	DRAWN BY	DART AEROSPACE USA, INC.	
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.		CHECKED	APPROVED	DRAWING NO.	REV. E
		DATE		D2650	SHEET 3 OF 5
				TITLE	SCALE
		06.03.30		SKIDTUBE	1:10

NO. 22884
WORK ORDER
SUBJECT TO A MEMORANDUM
WITHOUT NOTICE
UNCONTROLLED COPY
ENGINEERING
RETURN TO
SHOP COPY

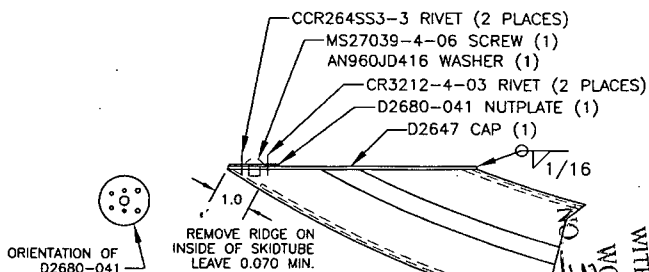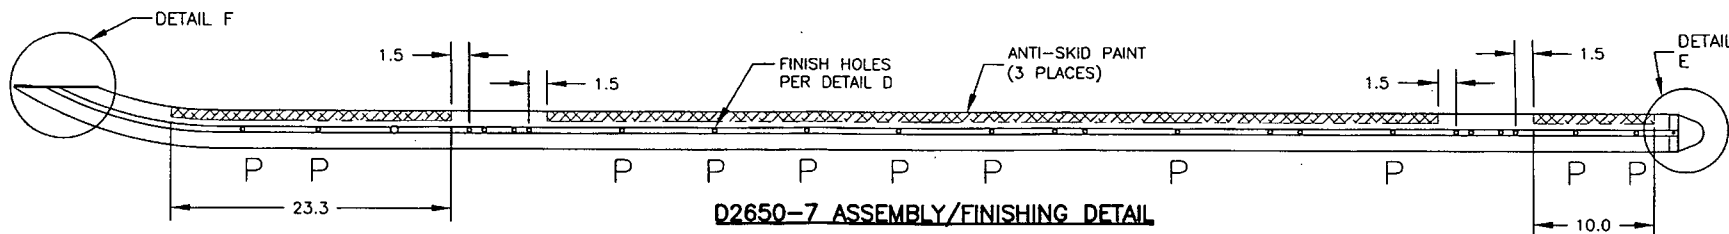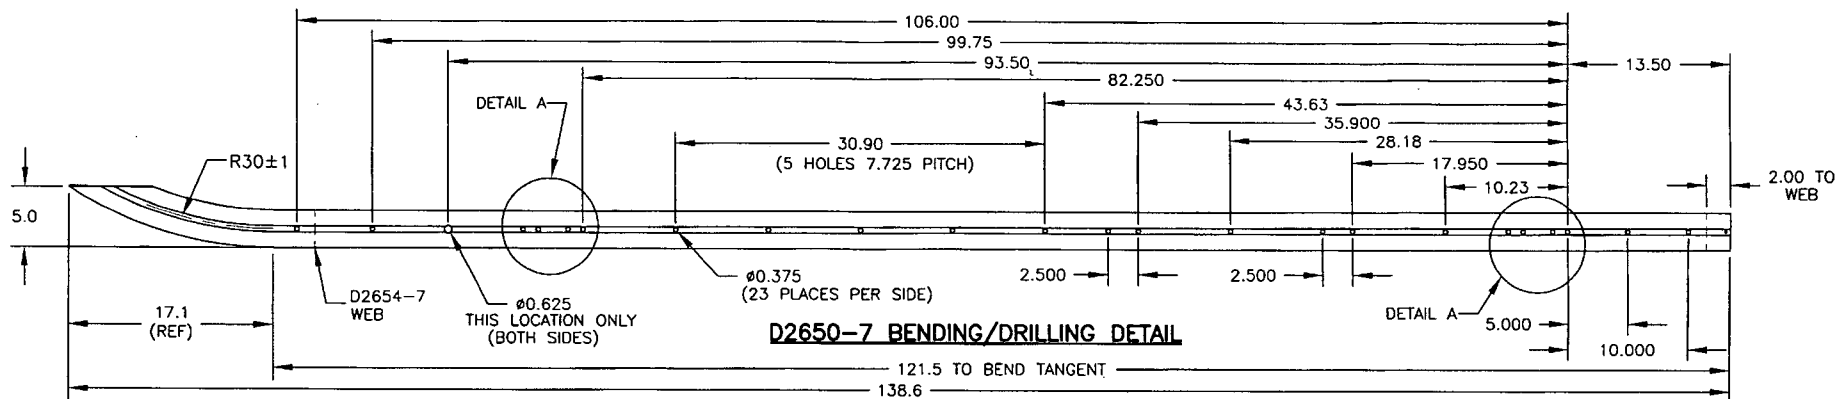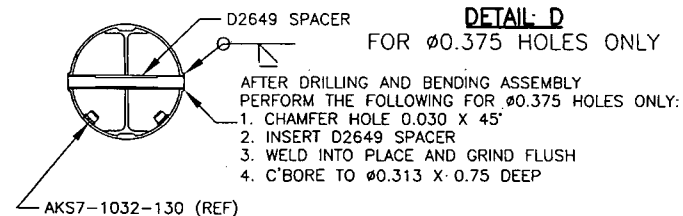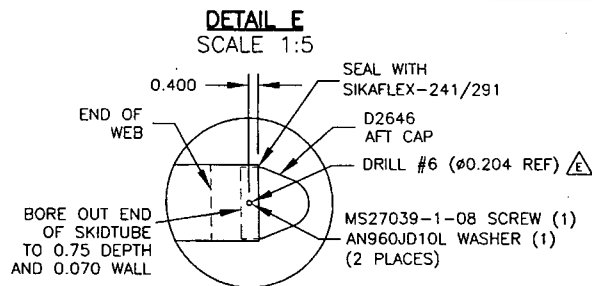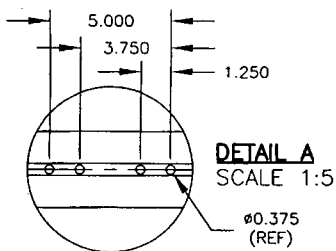

- DETAIL F (NOT TO SCALE)**
1. CUT TUBE LEVEL
 2. REMOVE RIDGE ON FWD SIDE
 3. LOCATE D2647 (TRIM AS NECESSARY)
 4. WELD D2647 IN PLACE PER DART QSI 004
 5. GRIND FLUSH
 6. RIVET D2680-041 NUT PLATE IN PLACE

NOTE: MASK THREADS IN D2680-041 PRIOR TO FINISH

SHOP COPY
RETURN TO
ENGINEERING
CONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE

WORK ORDER
25584

COPYRIGHT © 2004 BY DART AEROSPACE USA, INC.

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.

DESIGN	CF	DRAWN BY	CF	DART DART AEROSPACE USA, INC. PORT HADLOCK, WA	REV. E
CHECKED	PH	APPROVED	PH	DRAWING NO. D2650	SHEET 5 OF 5
DATE	06.03.30	TITLE	SKIDTUBE	SCALE	1:10

RELEASED

2017

NO. 120

AWS D17.1.2001
QUALIFICATION TEST RECORD

Name Barry Smith
Joint Welding Procedure Tig
Part number and Job number 206642541 / 1033631A

TEST WELDS REQUIRED

BASE METAL Alum WELDING PROCESS Tig
Penetration Complete ☐ Partial ☒ Single Weld ☒ Double Weld ☐
Current AC ☒ DC ☐ Backing YES ☐ NO ☒

	Position	Vertical	Down <input type="checkbox"/>	Up <input type="checkbox"/>
Sheet Groove	1G <input type="checkbox"/>	2G <input type="checkbox"/>	3G <input type="checkbox"/>	4G <input type="checkbox"/>
Tube Groove	1G <input type="checkbox"/>	2G <input type="checkbox"/>	5G <input type="checkbox"/>	6G <input type="checkbox"/>
Sheet Fillet	1F <input type="checkbox"/>	2F <input type="checkbox"/>	3F <input type="checkbox"/>	4F <input type="checkbox"/>
Tube Fillet	1F <input type="checkbox"/>	2F <input type="checkbox"/>	4F <input type="checkbox"/>	5F <input type="checkbox"/>

Crossbolt Spacer Welded into Skidtube

TEST RESULTS

Visual Pass ☒ Fail ☐
Penetration Pass ☒ Fail ☐
Crossbolt Spacer Pass ☒ Fail ☐

The above named individual is qualified in accordance with AWS D17.1.2001 to weld

Date of Test Coupon 07/07/30 Qualifier [Signature]